

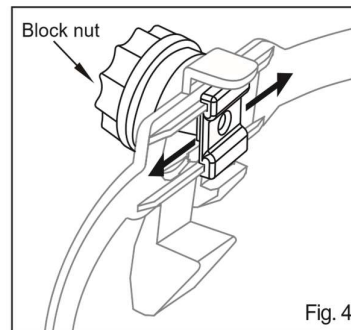
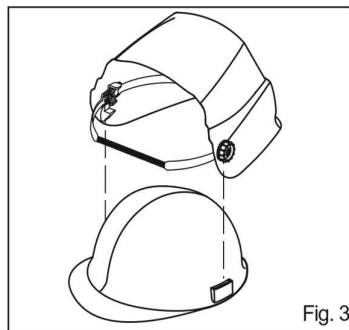


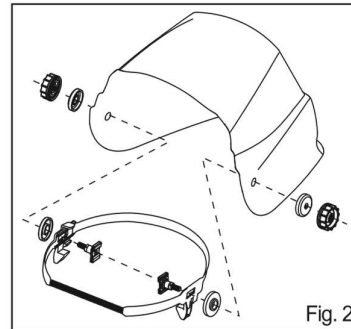

619114 SAFETY HELMET W/ FACE SHIELD INSTALLATION GUIDE

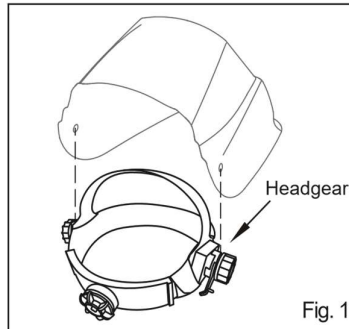

- Install hard hat adapter into welding helmet

Step 1: Remove headgear from your welding helmet, see Fig. 1.

Step 2: Install hard hat adapter into welding helmet, see Fig. 2.

- Assemble hard hat together with welding helmet

Step 1: Turn the hard hat brim to opposite position.

Step 2: Put adapter on the hard hat, see Fig. 2.

- Adjust the distance between the helmet and the face

Step 1: Loosen the block nut on both sides.

Step 2: Slide the helmet nearer or further from your face to proper position.

It is important that your eyes are each the same distance from the lens, see Fig. 3.

Step 3: Re-tighten the block nut when adjustment is complete, see Fig. 4.